SpetSee

WarmMark Data Sheet

Key Specifications	
Indication Type	Visual, irreversible white to red color change in activation window
Activation Method	Manual: Pull-tab
Activation Temperature Levels	Sensitivities available between -18°C and 37°C. See product selection table for details
Temperature Accuracy	±1°C/±2°F
Run Out Time	See product selection for details
Product Life	2 years from date of sale
Mounting Method	Pressure-sensitive adhesive (see Appendix B)
Storage Conditions	Store below the response temperature and below 55% relative humidity for optimal shelf life.
Dimensions	Short-Run: 1.81 x 0.75 x 0.06in / 46 x 19 x 1.5mm Long-Run & Duo: 3.88 x 0.75. x 0.06in / 98.1 x 19 x 1.5mm

WarmMark

WarmMark	Activation Temp	Run-Out Time*		Single Window Indicators			
Part Nur	nber	Window 1 Brief	Window 2 Moderate	Window 3 Prolonged	8°C / 46°F	8 hrs	
	1000/005			Ū	8°C / 46°F	12 hrs	
VM -18/0	-18°C/0°F	1 hour	3 hours	12 hours	25°C / 77°F	8 hrs	
VM 0/32	0°C/32°F	2 hours	12 hours	48 hours	26°C / 79°F	48 hrs	
NM 5/41	5°C/41°F	30 minutes	2 hours	8 hours			
WM 8/46	8°C/46°F	2 hours	12 hours	48 hours			
WM 8/46-8	8°C/46°F			8 hours			
WM 8/46-12	8°C/46°F			12 hours	WarmMark®		
WM 10/50	10°C/50°F	2 hours	12 hours	48 hours	Time - Temp Tag		
WM 20/68	20°C/68°F	2 hours	12 hours	48 hours	BRIEF	_ Color indicates exposur	
NM 25/77	25°C/77°F	30 minutes	2 hours	8 hours	MODERATE	warmer-than-acceptabl	
VM 25/77 - 8	25°C/77°F			8 hours	spotsee.io		
WM 26/79-48	26°C/79°F			48 hours	S AQ CHW		
NM 30/86	30°C/86°F	30 minutes	2 hours	8 hours			
WM 37/99	37°C/99°F	30 minutes	2 hours	8 hours	20°C/68°F	– Response temperature	

WarmMark Long-Run

WM Long-Run Part Number	Threshold Temp	Run-Out Time*				
		Line 1	Line 2	Line 3	Line 4	Line 5
WL 10/50	10°C/50°F	12 hours	30 hours	60 hours	110 hours	168 hours
WL 31/88	31°C/88°F	12 hours	30 hours	60 hours	110 hours	168 hours




SpetSee

WarmMark Data Sheet

WarmMark Duo

WarmMark Duo Part Number	Threshold Temp	Run-Out Time*			
		Window 1	Window 2	Window 3	Window 4
WD 10-34	10°C/50°F	3 days	8 days	14 days	-
WD 10-34	34°C/93°F	-	-	-	Within 30 mins

*Run out times are based on a constant temperature 2°C above the indicator temperature threshold. Exposure to higher temperatures will result in faster run out. Brief (Window 1) and Moderate (Window 2) time figures are for guidance, while the Prolonged (Window 3 or only window) is controlled to the time specification.



- Provides a second indicator for higher temperature set point of 34°C (93°F)

Pressure-Sensitive Adhesive Data

Product Description

- High performance, acrylic pressure-sensitive adhesive (2 mil thick film) that provides excellent adhesion to most smooth surfaces
- Provides aggressive tack and high shear strength
- Excellent UV light stability and elevated temperature resistance

Physical Properties	Typical Values*
Quick Tack Stainless Steel	4.0 lbs./sq.in.
Peel Adhesion Stainless Steel - 30 minute residence	4.1 lbs./in.
Shear Stainless Steel - 1000 g/sq. in.@ 72°F	300+ hours to fail
Thickness Adhesive only	.002 inches

Temperature Range Guidelines

Application: Above 10°C/50°F for best performance **End Use:** -40°C to 121°C/-40°F to 250°F

Chemical Resistance

Resistant to water, detergent, alcohol, aliphatic and some aromatic hydrocarbons. Not recommended for use in contact with active solvents such as ketones, esters, and some chlorinated hydrocarbons.

*Values given are typical and are not necessarily for use in specifications. Product reinforced with 2 mil PET during adhesion tests.

How to Mount

Temperature indicators are best suited for monitoring product or the controlled environment of the product.

WarmMark ascending temperature indicators are best used when mounted directly to the product being monitored or when placed inside the product shipper. Indicators should not be placed directly on gel packs, phase change materials, etc. as this will result in measuring the temperature of the packaging material components instead of the temperature of the product or environment.


In rare cases, temperature indicators are mounted on external packaging to monitor ambient temperature conditions.

SpetSee


WarmMark Data Sheet

Drawings

WarmMark

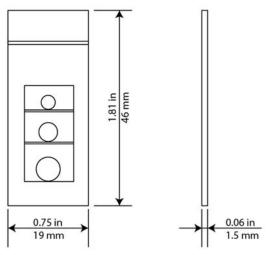

WarmMark Long Run



WarmMark Duo

