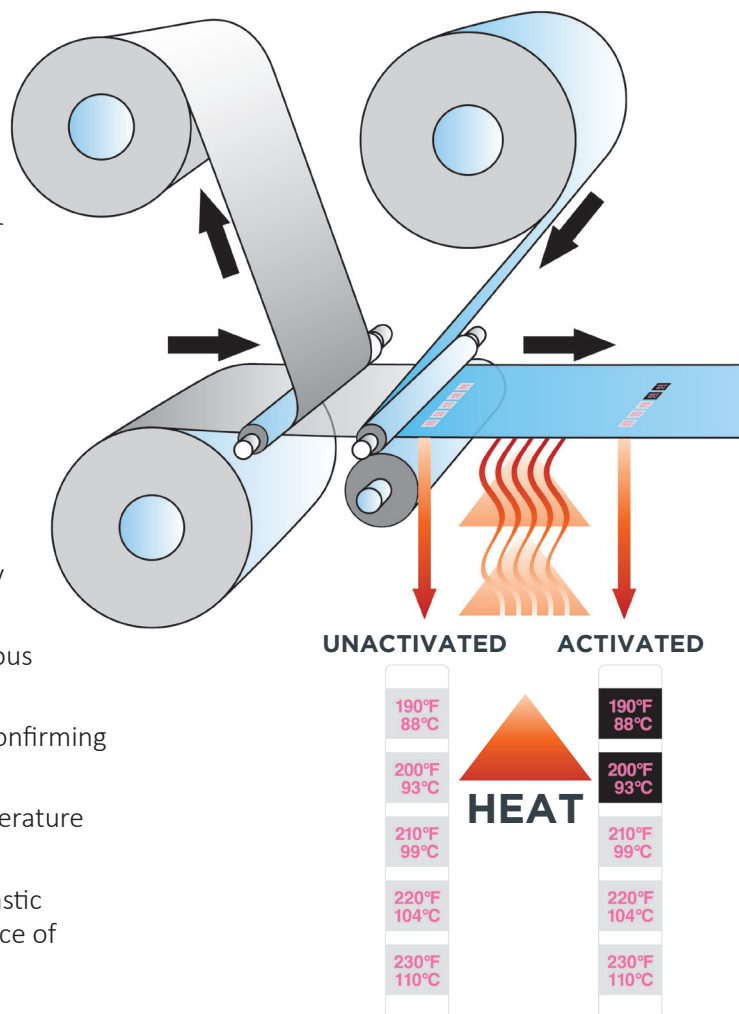# SpotSee®

Thermostrip™ DC - Temperature Tape for Drying and Curing

Every link in the cold chain is crucial to your product's safety and quality. Temperature Thermostrip™ DC is a highly accurate heat indicator designed for use within a drying, curing, laminating or bonding process.

- The individual strip has 5 temperature settings that when exposed to heat will permanently change color from silver to black Indicating attained temperature.

- Attach to the product in process

- For use in dry applications

- Permanent visible record

- Eight (8) temperature sets

Perfect For

- Heat Indicators within curing systems found on many web and laminating presses.

- Assisting with determining how UV inks react at various temperatures.

- Temperature testing when using a fusing machine, confirming temperature at bonding site.

- Insuring that garments finished or pressed in a temperature tunnel - do not overheat.

- For use during screen printing, textile processing, plastic laminating and curing printing inks to provide evidence of attained temperature.

UNACTIVATED   ACTIVATED

HEAT

Code #	Set	Temperature Range °C					Specifications
P9016-16	1	37°	40°	44°	49°	54°	• 7°C to 260°C
P9016-16	2	60°	65°	71°	77°	82°	• 10 mm x 56 mm
P9017-16	3	88°	93°	99°	104°	110°	• Self-Adhesive label
P9018-16	4	116°	121°	127°	132°	138°	• Accuracy Set 1 & 2 Tolerance: ± 1°C
P9019-16	5	143°	149°	154°	160°	166°	Set 3 & 4 Tolerance: ± 1.5°C Set 5 – 8 Tolerance: ± 4°C
P9020-16	6	171°	177°	182°	188°	193°	
P9021-16	7	199°	204°	210°	216°	224°	• 16 labels per set
P9022-16	8	232°	241°	249°	254°	260°	